


## Fault Finding Logic For Control Box Type 535 SE/LD

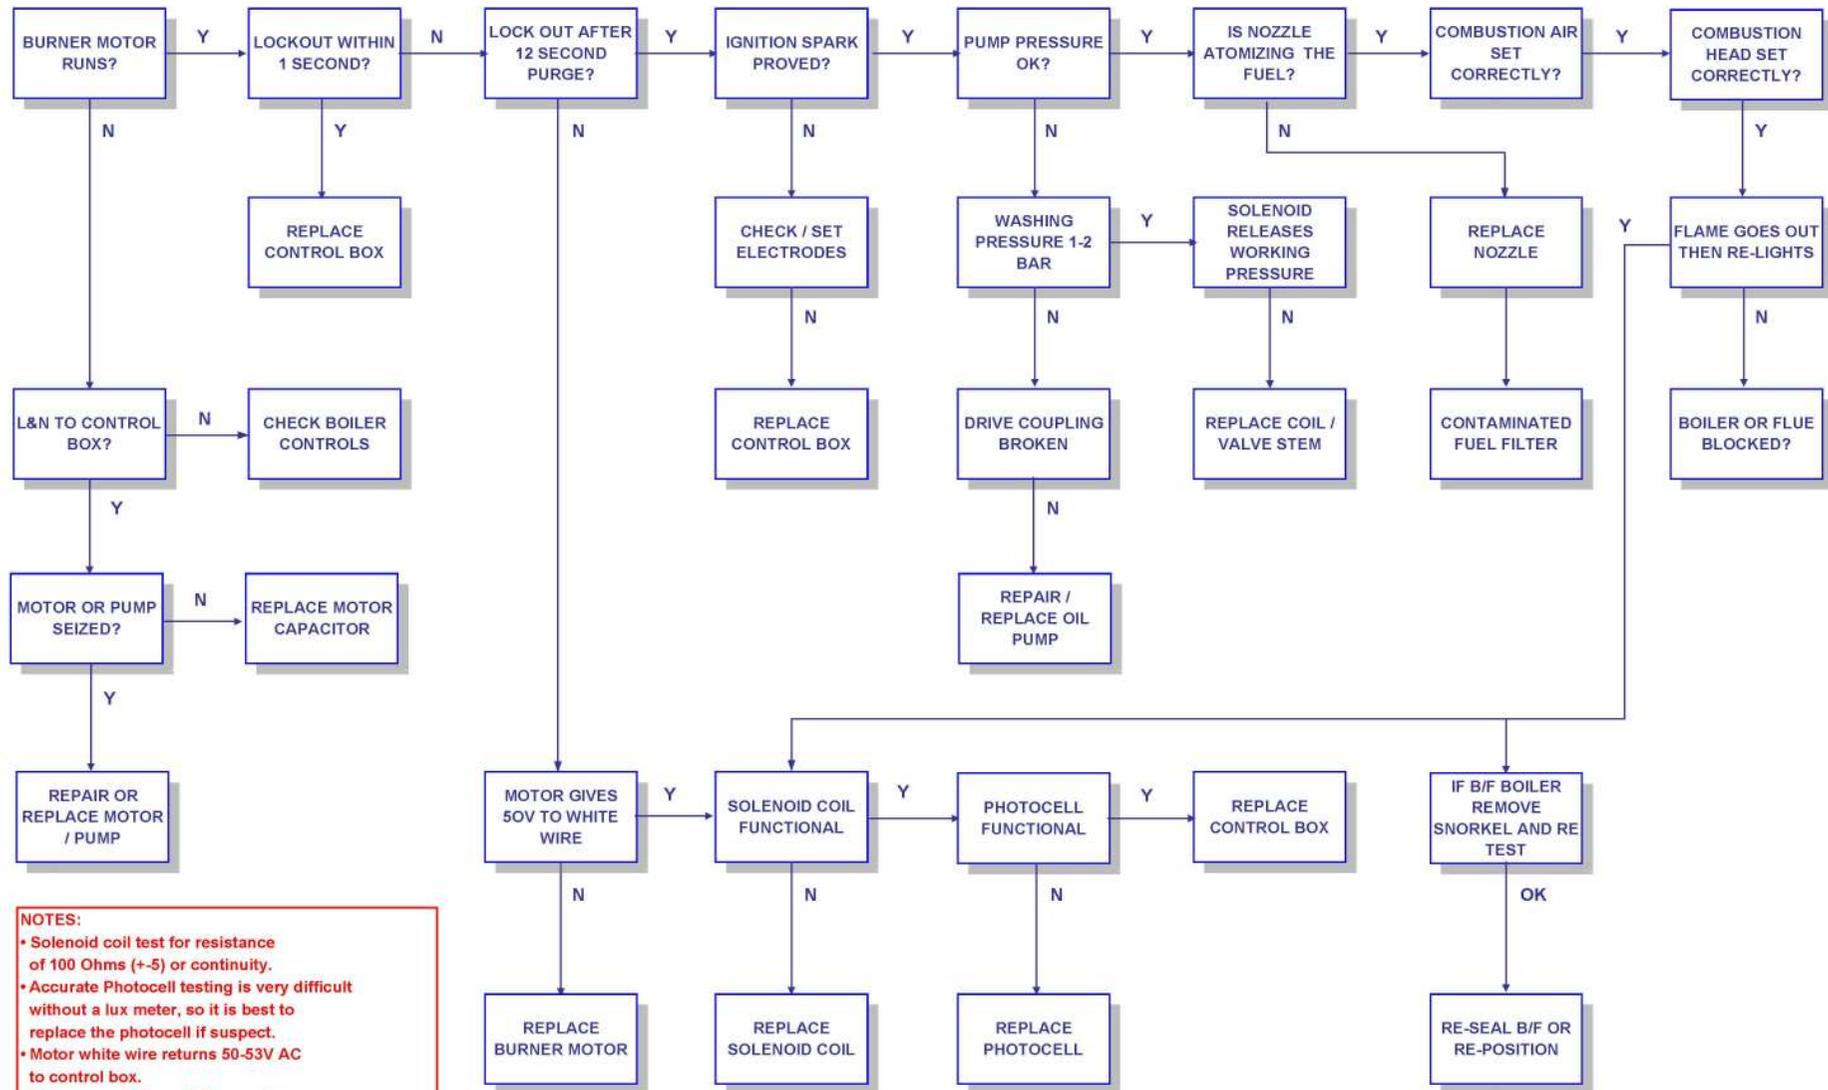

**NOTES:**

- Solenoid coil test for resistance of 100 Ohms (+5) or continuity.
- Accurate Photocell testing is very difficult without a lux meter, so it is best to replace the photocell if suspect.
- Motor white wire returns 50-53V AC to control box.
- Burners on Balanced Flue systems can recirculate flue products resulting in burner recycling. If this happens check flue position and sealing.